

Work Order ID 151600

Monday, October 03, 2016 2:51:46 PM

151600

Page 1

Item ID: D350-748-243TRN

Revision ID:

Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016 Start Qty: 1.00

Required Date: 10/10/2016 Req'd Qty: 1.00

Reference:

Accept
SCRAP

N9000040100

Setup Start *NS1*

Stop *NS2*

Cust Item ID:

Customer:

Approvals: Process Plan: DAE 21 9-8 Date: OCT 03 2016

Tooling:

Date:

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D350-748-243	A

100

0.00

100

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

0.30

1-Cut tube on chop saw, leave extra mat'l for facing and install plugs 350-241 on both ends.

2-Face both sides of tube.

3- Turn program 02000 section on both side as per folio FB468.

4- Turn program 03000 section on both side as per folio FB468.

5- Blend transsition lines only with belt sander 60 grit

Folio rev: AA
Dwg rev: G

1 0 UHF

16/10/13

110

110

QC

Quality Control

QC2- Inspect parts off machine FAI/FAIB

0.00

Memo

0.00

1 0 UHF

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐	AGAINST DEPARTMENT/PROCESS Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:		QTY Effective :		MRB (QSI042) Approval			
Description Work Order Deviation			Disposition					
						Completed By		
						Lead hand / Supervisor Approval Verification		
QC / QA Coordinator Approval								

Root Cause	FAULT CATEGORY		
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐
Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____	

Work Order ID 151600***151600***

Page 2

Monday, October 03, 2016 2:51:46 PM

Item ID: D350-748-243TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/10/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.00

120

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.49

Mori Seiki CNC Lathe Large

1- Turn program 04000 section on both side as per folio FB468.

2- Turn program 05000 section on both side as per folio FB468.

3- Blend transsition lines only with belt sander 60 grit

4-Scribe part # as per Dwg D350-748-243

Folio rev: 4/4Dwg rev: 4/4

130

0.00

130

QC

Quality Control

QC2- Inspect parts off machine FAI/FAIB

Memo

0.00

PERFORME ULTRASONIC MEASURMENT

DQA:

Date:

JAN 5 / 2018

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

DEC 7 2017

Work Order update only ☐

Work Order: <u>151600</u>		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. <u>D350-748245TEN</u>		Rework ☐		Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐		
NCR No. <u>17-6718</u>		Scrap ☒		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date: <u>17-03-13</u>		Step #: <u>100</u>		QTY Effective: <u>1</u>				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
Due to vibration tube is 0.020" UNDER tolerance As indicated on FAI sheet. I nominal: 0.523 I deviation: 0.468 (cumulative)				0.120" 0.124" 0.123" 0.190" Wall thickness @ Indicated Location on Drawing SCRAP. High stress area. Section properties too low. 4/17/3/21				<u>17-03-21</u> Lead hand / Supervisor Approval Verification	
								<u>17-03-21</u> QC / QA Coordinator Approval	
								<u>17-03-21</u> PD	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☒				
Equip/Tooling ☒	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☒	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER: ☐							

Work Order ID 151600

Monday, October 03, 2016 2:51:46 PM

151600

Page 3

Item ID: D350-748-243TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Crosstube Installation, High Aft**Start Date:** 10/3/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 10/10/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control									
150	Large Fab	0.00							
150									
Crosstubes	Memo	0.20							
Crosstubes	1-Grind machining marks								
190	Packaging	0.00							
190									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack Location: _____								

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Work Order ID 151600***151600***

Page 4

Monday, October 03, 2016 2:51:46 PM

Item ID: D350-748-243TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Installation, High Aft

Stop ***NS2***

Start Date: 10/3/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/10/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start ***NR1***

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

200

QC21- Final Inspection - Work Order Release

0.00

200

QC

Memo

0.20

Quality Control


SEP 18 2017

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Monday, October 03, 2016 2:51:50 PM

Page 1

Work Order ID: 151600

151600

Parent Item: D350-748-243TRN

D350-748-243TRN

Parent Item Name: Crosstube Installation, High Aft

Start Date: 10/3/2016

Required Date: 10/10/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev: PRELIM New Issue LL 12.05.08

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6021-125		Manufactured	No				Each	41.0000		1			

D6021-125

Crosstube Material - 17-4Ph SS

Location

Loc Qty

Loc Code

HALL

25

(127271)

25

LG

16

127272

16

UHG
10/10/13

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					


DART AEROSPACE LTD		Work Order:	151600
Description: Crosstube Assembly (AS350/355 High Aft SS)		Part Number:	D350-748-243
Inspection Dwg: D350-748-243 Rev: A		Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+/-0.005					
	2.180	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.208	+0.005/-0.000					
	2.234	+0.005/-0.000					
	2.253	+0.005/-0.000					
	2.272	+0.005/-0.000	2.252		✓	Vernier	
	2.299	+0.005/-0.000	2.299	✓		Vernier	
	0.063	+/-0.010	0.063				
	5.25	+/-0.060					
	R0.063	+/-0.010	R0.063				
	R0.50	+/-0.030	R0.50			Vernier	
SIDE B	2.240	+/-0.005					
	2.180	+0.005/-0.000					
	2.180	+0.005/-0.000					
	2.208	+0.005/-0.000					
	2.234	+0.005/-0.000					
	2.253	+0.005/-0.000					
	2.272	+0.005/-0.000					
	2.299	+0.005/-0.000	2.299	✓		Vernier	
	0.063	+/-0.010	0.063	✓			
	5.25	+/-0.060					
	R0.063	+/-0.010	R0.063	✓			
	R0.50	+/-0.030	R0.50	✓		Vernier	
	124.70	+/-0.060	124.70	✓		Tape	

DART AEROSPACE LTD		Work Order:	151600
Description: Crosstube Assembly (AS350/355 High Aft SS)		Part Number:	D350-748-243
Inspection Dwg: D350-748-243 Rev: A		Page 2 of 2	

WALL THICKNESS MEASUREMENT

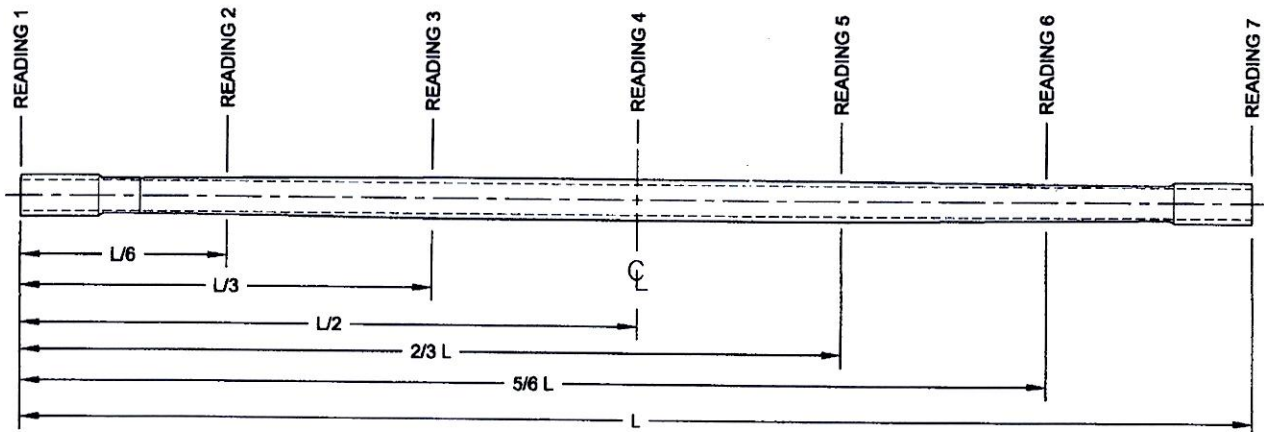

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"						0.030"
READING 2 L=						
READING 3 L=						
READING 4 L=						
READING 5 L=						
READING 6 L=						
READING 7 L=						

Calibration Result

Actual Block Thickness: _____

SITESCAN 250 Measured Thickness: _____

Measured by:	Audited by:	Preliminary Approval:
Date:	Date:	Date:

Rev	Date	Change	Revised By	Approved
A	15.09.09	New Issue (P/O D350-748-203)	KJ	

Item	Qty	Part Number	Description
	-243		
1	X	D350-748-243	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
2	1	D6021-125	CROSSTUBE
3	2	D3502-1	SUPPORT
4	2	D5123-7	CLAMP CUSHION
5	1	AETC-1032	INSERT
6	2	MS21920-20 OR MS21920-21/-22	CLAMP (PER DART SPEC. M-MS21920-20/-21/-22)
7	1	NAS1149C0363R	WASHER (OR AN960C10)
8	1	NAS1635-3-8	SCREW (OR MS51958-63)
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6021-125
FINISHED LENGTH AFTER TURNING = 124.70±0.06 (AFTER BENDING/TRIMMING = 122.70 REF)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-243" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 29.85 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.290 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 8% BASED ON O.D. ON TOP HALF OF BEND, AND 8% ON BOTTOM HALF OF BEND.
- 12) MAX AMPLITUDE OF RIPPLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 13) MAX TWIST: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- 14) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TIGHTENING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 151600 MJS
16P-03

DEO ATTACHED

RELEASED

2015 MAR 18 qf

RELEASED


2015 MAR 18 CK
qf RCN 15/547 qf 14/2/25

UNDER REVIEW


15/4/25 CK
qf 15/541 qf 16/2/25

A	NEW ISSUE	CP	15.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	15.01.21		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D350-748-243	REV. A SHEET 1 OF 4
TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

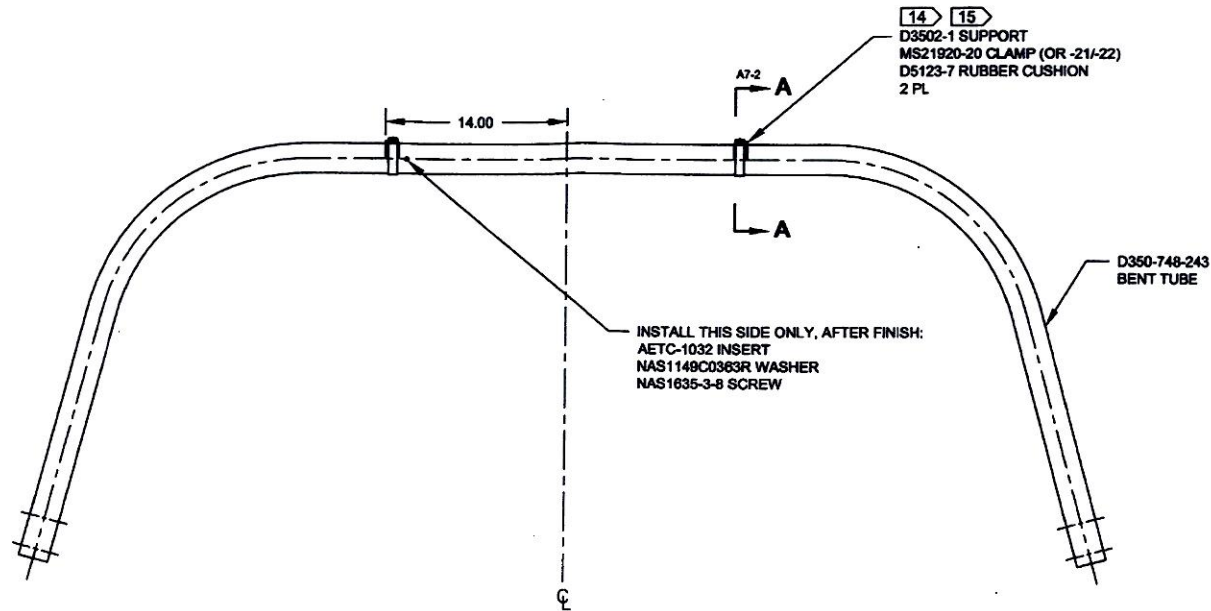

**D350-748-243
ASSEMBLY DETAIL**

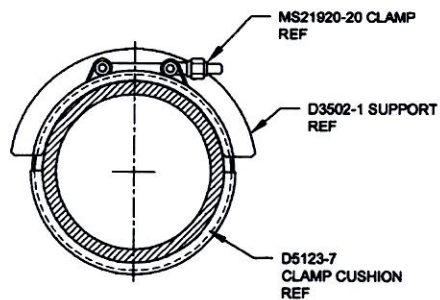

SECTION A-A D4-2
SCALE 6X

DEO ATTACHED


UNDER REVIEW

RELEASED


OK 8/14/22
9/16/24

2015 MAR 18

DESIGN	92	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	92		
CHECKED	A.P.	DRAWING NO.	REV. A
MFG. APPR.	7/4	D350-748-243	SHEET 2 OF 4
APPROVED	7/4	TITLE	SCALE
DE APPR.	7/4	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

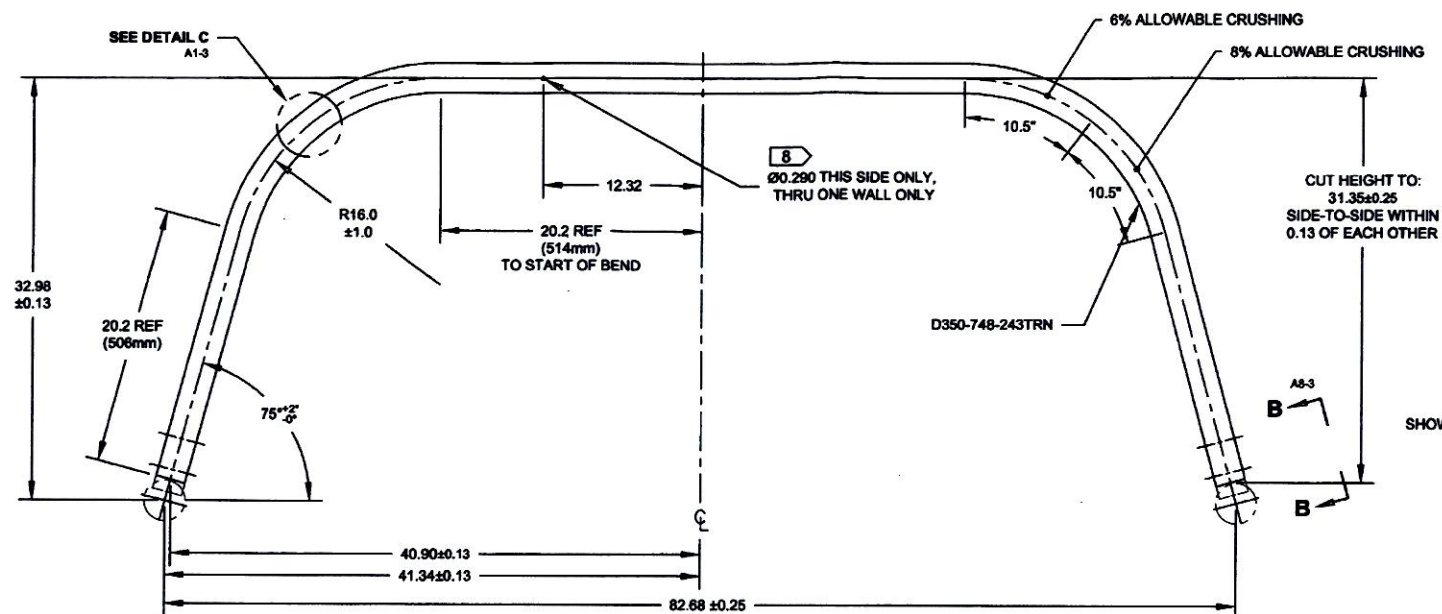

D350-748-243
BENDING AND DRILLING DETAIL 11

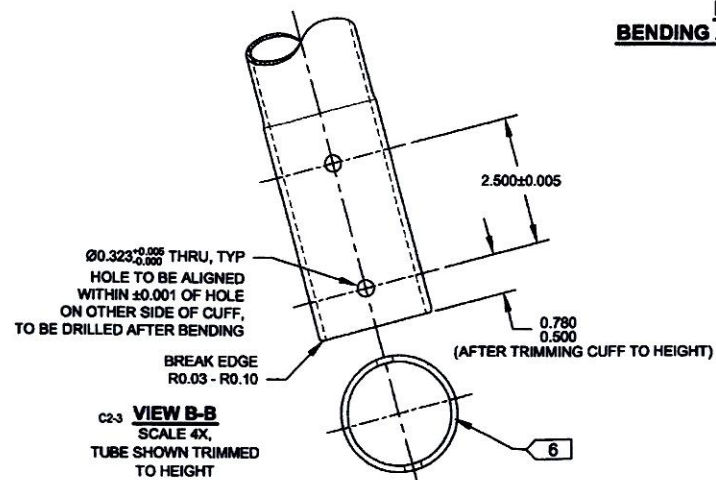


VIEW B-B
SCALE 4X,
TUBE SHOWN TRIMMED
TO HEIGHT

DEO ATTACHED
RELEASED

2015 MAR 18 *up*


UNDER REVIEW

42 15/11/20 *OK* *9/12/20*

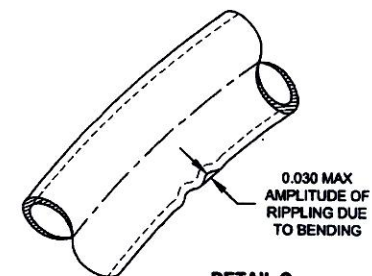

DETAIL C D7-3
SCALE 4X
RIPPLING EXAGGERATED

DESIGN	<i>g</i>	DART AEROSPACE LTD	
DRAWN	<i>g</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. A
MFG. APPR.	<i>[Signature]</i>	D350-748-243	SHEET 3 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

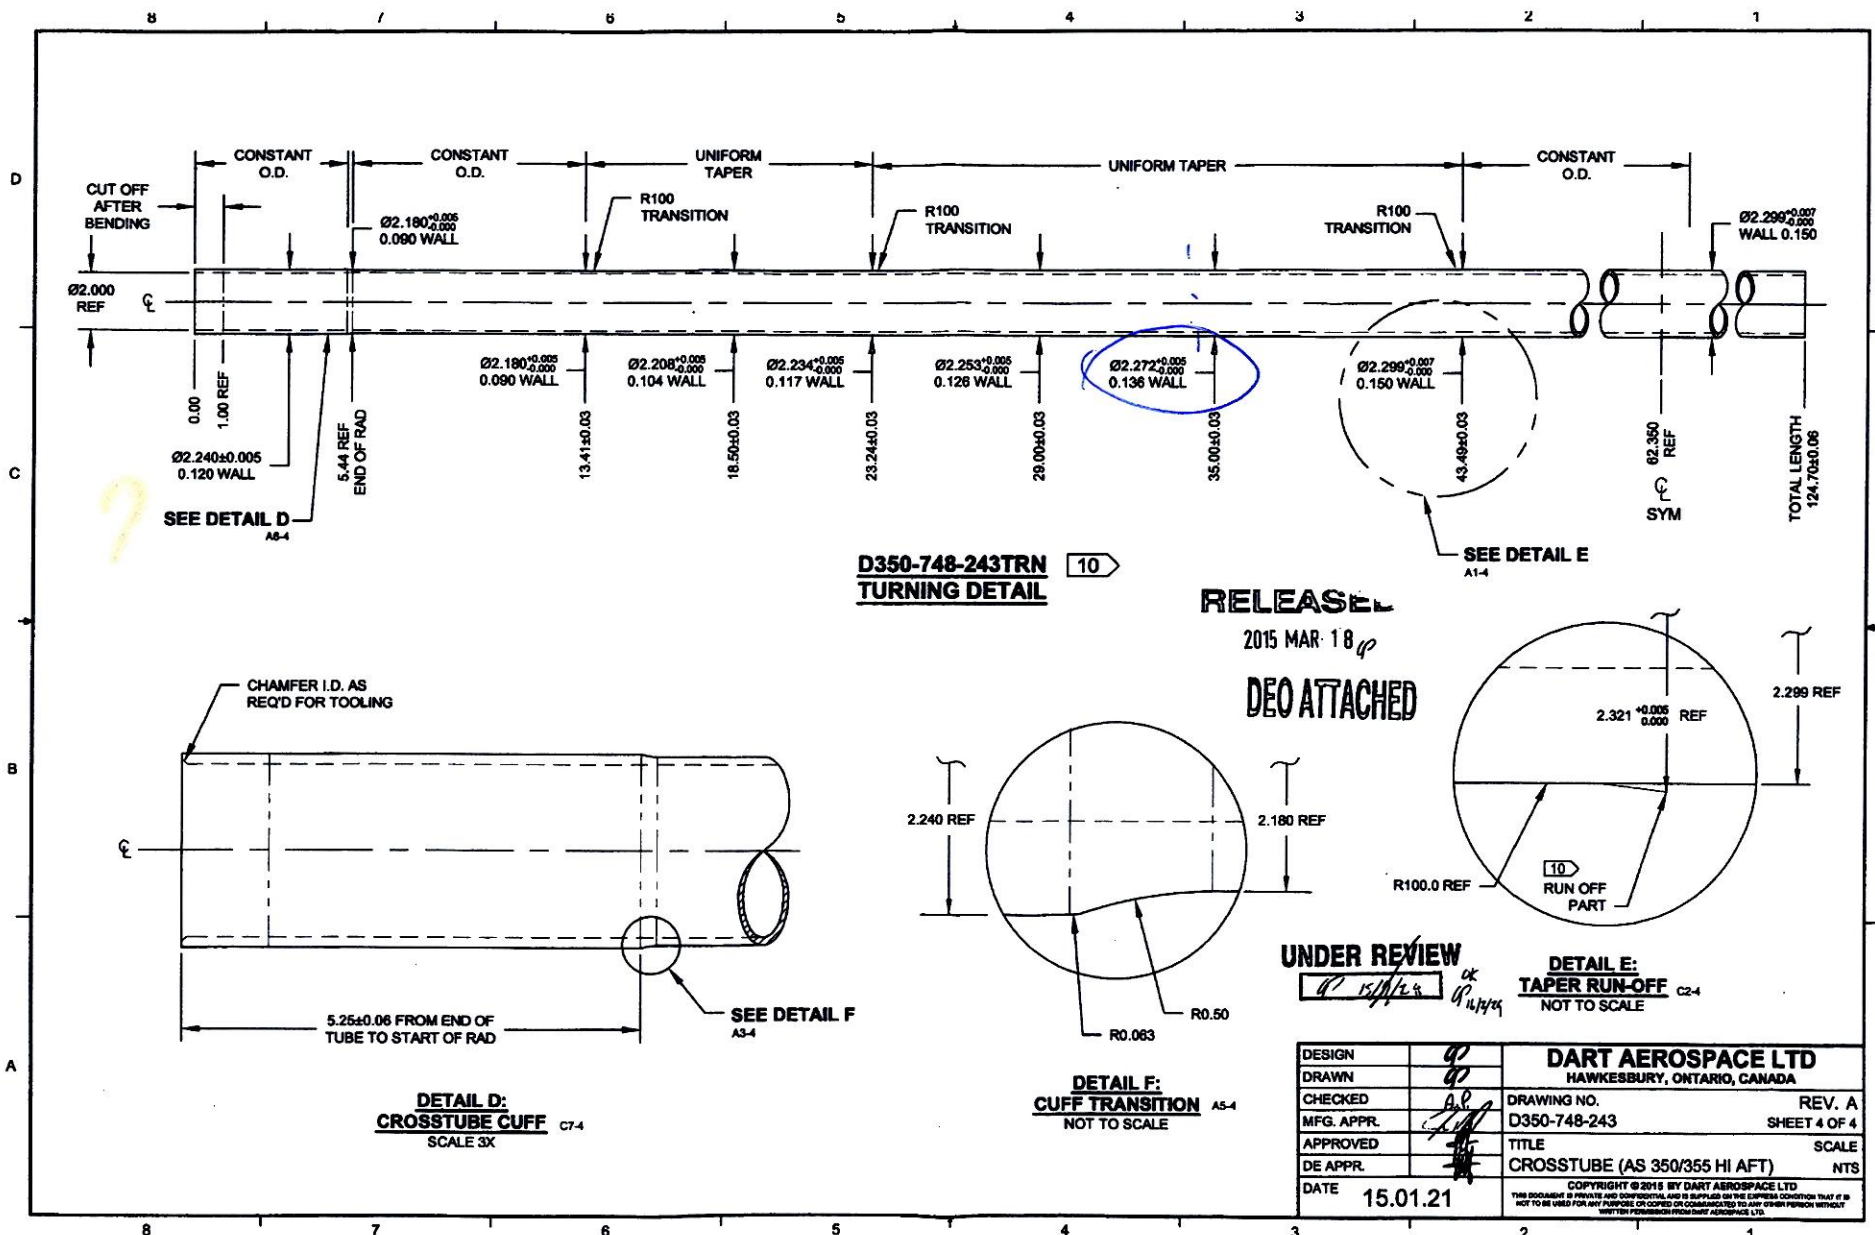

D350-748-243TRN
TURNING DETAIL

10

RELEASE

2015 MAR 18

DEO ATTACHED

UNDER REVIEW

15/1/25
14/4/25

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE C2-4

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. A
MFG. APPR.	90	D350-748-243	SHEET 4 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D350-748-243	TITLE CROSSTUBE	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D350-748-243-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 15.11.18	DATE 15.11.18	DATE 16.02.19	DATE FEB 19 2016		DATE 2016.02.19		

AMEND NOTE 2 (SHEET 1) AS FOLLOWS:

- 2) FINISH: PREPARE SURFACE PER DART QSI 005 4.1.4
 PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
 PAINT OUTSIDE PER DART QSI 005 4.2
 OR
 POWDER COAT WHITE (4.3.5.2) PER DART QSI 005 4.3

RELEASED
 2016-02-26
 EN 16-534 *[Signature]*

COPYRIGHT © 2015 BY DART AEROSPACE LTD
 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
 NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
 WRITTEN PERMISSION FROM DART AEROSPACE LTD.